

82 Body

Complaint:

Speed-related interference to radio reception and cassette operation, model 124.0


Cause/Remedy

This interference (ignition interference) can be transmitted inductively by the wiring harness, which runs below the radio set.

Move terminal block, terminal 58d (X6) to the left. Install bracket (6) for this purpose. Re-attach wiring harness with clip (7) and cable strap (8).

Bracket part no. 124 545 20 40

Clip part no. 123 995 08 20

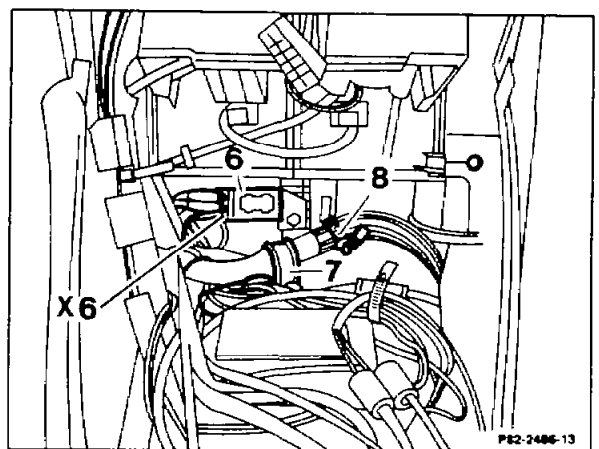

Complaint:

Crackling noises in radio when Ignition switched on

Cause/Remedy

1 Model 124 with RÜF/KAT fuel injection engines.

Interference may be caused by the KE control unit. To locate fault, unplug multiple coupling from KE control unit.

2 Vehicles with heated outside rear-view mirror. Thermostat in mirror glass faulty. To locate fault, unplug electrical connection at mirror; replace mirror glass, if necessary.